


## Threshold Offset Contributions INPUT STAGE TO TRACK DISCRIMINATOR

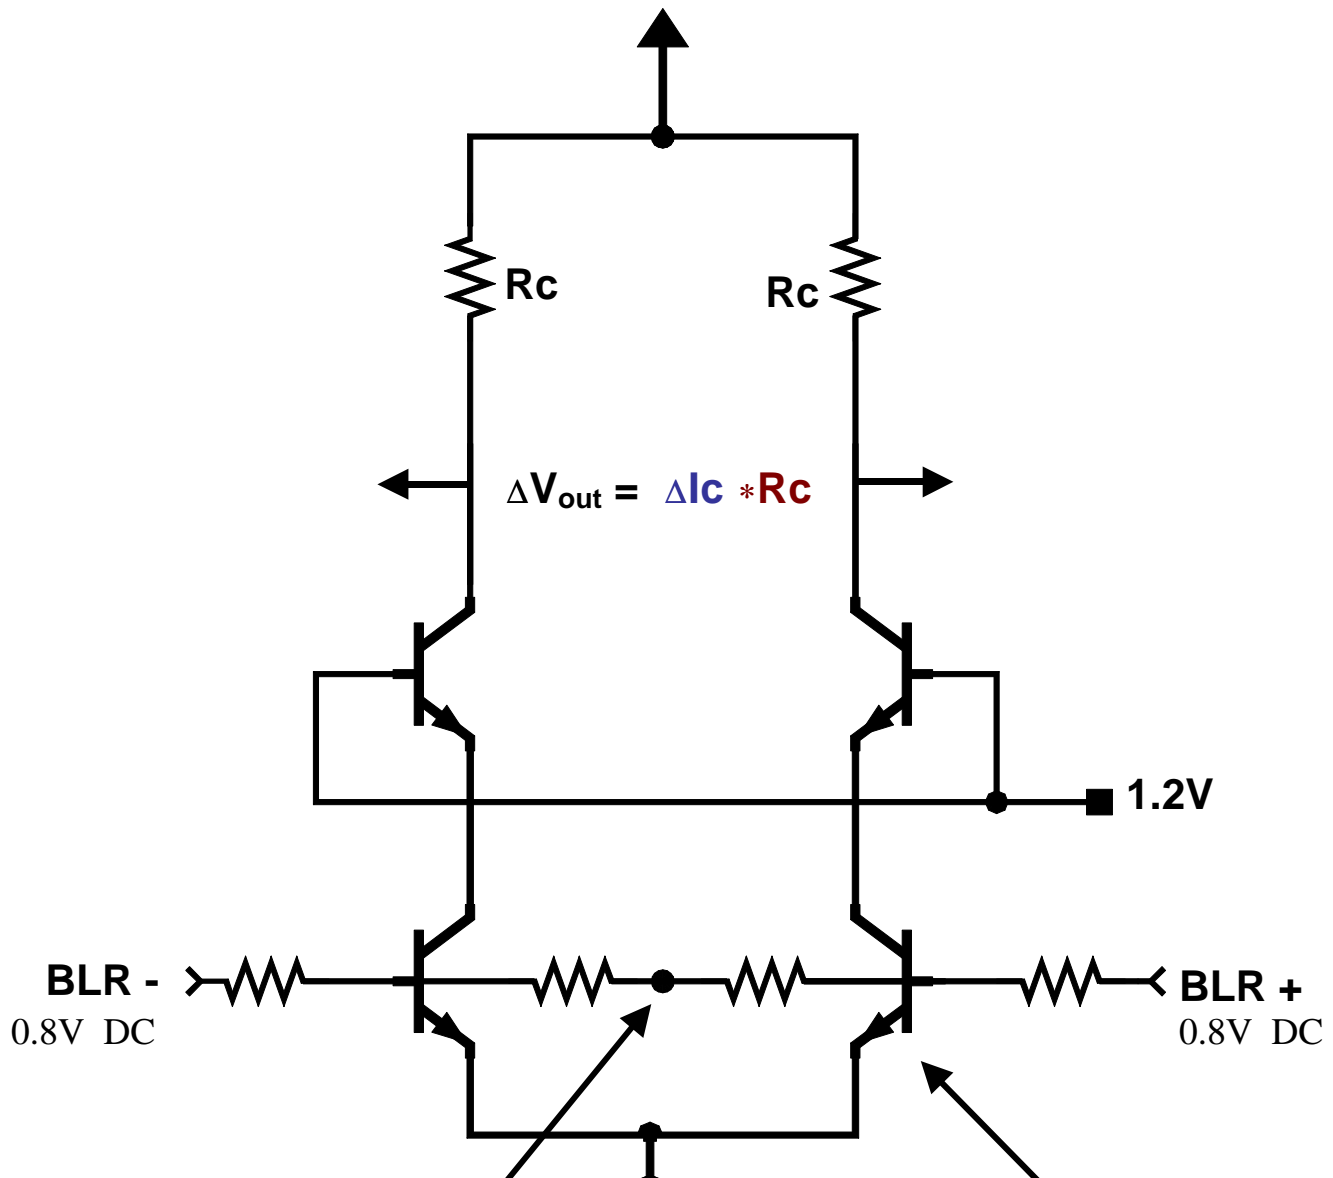

Connected to GND in ASDBLR99  
DC current through unpredictable resistor  
mismatch contributes threshold uncertainty.  
Process mismatch was larger than expected

Removed GND reference in Rev 00.

Larger than Expected  $\Delta V_{be}$   
mismatch increased threshold  
Uncertainty.

FMN

UPENN